




category:




**SF FLOOR NW** No need to apply the wax. Just by easy cleaning, beautiful appearance can be maintained for long. SF FLOOR NW is a 2.8mm vinyl sheet with foamed layer which has excellent shock absorption and durability.

	With oddinon balon	8						
Charification	overall thickness	2.8mm	width x length	1820mm x 9m				
Specification	others Antibacterial Finished / Highly Durable UV-Coated Surface							
JIS Registered No.	IS Registered No. NO.GB0507188 (JIS A 5705 Vinyl Sheet Flooring)							
Packing	Packing 9m/roll							
Net Weight	41.0kg/roll							
Performance	Wear Resistance	(EN649) Group T						
	dried mortar and concrete	Eco Royal Cement, Eco AR600						
	heavy traffic use	Epo GrayS, US Cement						
Recommended Adhesive from TOLI	The wards and living rooms where beds with double-row casters are used	Epo GrayST, US Cement, US Cement (less-smelly)						
	humid mortar and concrete	Epo GrayST, US Cement, US Cement (less-smelly)						
	TOLI UNDERLAY SHEET	US Cement, US Cement (less-smelly), US200						
Welding/Seam Finish	◆Welding rod for heat-welding (antibacterial finished) is available on a color-by-color basis. ◆JOINT SHIELD method (JS Method) by TOLI JOINT SHIELD is also applicable.							
Notes on Installation	+Seams should be heat-welded or finished with TOLI JOINT SHIELD.  +TOLI JOINT SHIELD can be used only for 2.8mm thickness. For 3.5mm thickness, please finish the joints with welding rods.  +If you install SF FLOOR NW 3.5mm on UNDERLAY SHEET, seam joints should be finished with heat-welding. Do not use TOLI JOINT SHIELD.  +When you install 2 different sheets, each edge should be jointed at the seam. (Do not cut in the middle of the sheet.)  +Please do not use the urethane adhesive other than US Cement, US Cement (less-smelly).(except using TOLI UNDERLAY SHEET)  +For one week after installation, direct sunlight, sudden change of temperature due to air conditioning, and water washing should be avoided.  +As the sub-floor material, the underlayment like TOLI UNDERLAY SHEET (page 278) is also workable. Apply the same adhesive for both upside and downside of the underlayment.							
Recommended Way of Maintenance from TOLI	<ul> <li>◆No need to apply the maintenance wax on the surface. Clean the floor every day with an auto scrubber or a wet rag wrung out tightly. Use the detergent for fixed contamination.</li> <li>◆Even if the wax is applied on the surface, it does not affect the quality of NW series.</li> <li>◆For a large facility, an abstergent auto scrubber is more recommendable.</li> <li>◆High speed buffing should be avoided. Otherwise highly durable UV coating will be abraded.</li> </ul>							
Custom Order	If you ask for a different thickness, please contact TOLI sales rep.							
Others	At the entrance of the building, the dust control mat should be laid in order to avoid soils and sands from outside.  The dirt and stains will be more visible on the floor covering with lighter plain colors, compared to dark colors. Also they are more likely to stick with the deep-embossed surface than the flat surface.  Please be aware that some rubber casters might cause color-contamination.  Please note that the product has the indigenous oddy from its materials.							

MADE IN JAPAN



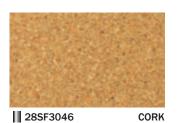

◆Please note that the product has the indigenous odor from its materials.









28SF3045 TATAMI

◆ Antibacterial Performance <in accordance with JIS Z 2801> In JIS testing criteria, when the value is more than 2.0, the product has sufficient antibacterial property.

		Escherichia Coli	Staphylococcus Aureus	MRSA
SF FLOOR NW		More than 2.0	More than 2.0	More than 2.0
	Conducto			





## **SF FLOOR NW**



category: low-maintenance vinyl sheet with cushion backing







| 28SF3034 WALNUT



**■ 28SF3037** MAPLE



28SF3040 OAK



28SF3031 NOCE



28SF3035 WALNUT



28SF3038 MAPLE



28SF3041 OAK



28SF3032 NOCE



28SF3036 WALNUT



28SF3039 MAPLE



28SF3033 NOCE

◆ Chemical Resistance <in 1454="" a="" accordance="" jis="" with=""> A: No change B: Slightly changed C: Changed D: Eroded (damaged) (overall evaluation based on coloring, material and gloss</in>									
	Inorganic Acids		Alkali						
SF FLOOR NW	H <sub>2</sub> SO <sub>4</sub> 50%	HNO <sub>3</sub> 61%	HCL37%	NH <sub>3aq</sub> 28%					
	В	С	В	A					
						Disinfectant			
	lodoform	Oxygrnated Water 31%	Hibitane Tincture	Disinfecting Ehtanol	Sodium hypochlorite	Welpas			
	С	Α	Α	Α	A	Α			



